



ENGLISH


User manual



TABLE OF CONTENTS

1. PRECAUTIONS AND SAFETY MEASURES	2
1.1. Preliminary instructions	2
1.2. During use	3
1.3. After use	3
1.4. Definition of measurement (overvoltage) category	3
2. GENERAL DESCRIPTION	4
3. PREPARATION FOR USE	4
3.1. Initial checks	4
3.2. Instrument power supply	4
3.3. Storage	4
4. NOMENCLATURE	5
4.1. Instrument description	5
4.2. Alignment marks and hand protection	5
4.3. Description of functions keys	6
4.3.1.  key	6
4.3.2. HOLD/MAXMIN key	6
4.3.3. RANGE key	6
4.3.4. HFR key	6
4.3.5.  key	6
4.3.6. Disabling the Auto Power Off function	6
5. OPERATING INSTRUCTIONS	7
5.1. AC Current measurement	7
5.2. Leakage current measurement	8
5.3. Bluetooth connection with HTLeakage APP	9
6. MAINTENANCE	10
6.1. General information	10
6.2. Batteries replacement	10
6.3. Cleaning	10
6.4. End of life	10
7. TECHNICAL SPECIFICATIONS	11
7.1. Technical characteristics	11
7.1.1. Technical specifications for measures according to EC/EN61557-13 Class 2	12
7.1.2. Electrical specifications	12
7.1.3. Reference guidelines	12
7.1.4. General characteristics	12
7.2. ENVIRONMENT	13
7.2.1. Environmental conditions for use	13
7.3. Accessories	13
7.3.1. Standard accessories	13
8. SERVICE	14
8.1. Warranty conditions	14
8.2. Service	14

1. PRECAUTIONS AND SAFETY MEASURES

The instrument has been designed in compliance with directive IEC/EN61010-1 relevant to electronic measuring instruments. For your safety and in order to prevent damaging the instrument, please carefully follow the procedures described in this manual and read all notes preceded by the symbol  with the utmost attention.



CAUTION

Failure to comply with the caution notes and/or instructions may damage the instrument and/or its components and be a source of danger for the operator.

Before and after carrying out the measurements, carefully observe the following instructions:

- Do not carry out any current measurement in humid environments.
- Do not carry out any measurements in case gas, explosive materials or flammables are present, or in dusty environments.
- Avoid contact with the circuit being measured if no measurements are being carried out.
- Avoid contact with exposed metal parts, with unused measuring probes, circuits, etc.
- Do not carry out any measurement in case you find anomalies in the instrument such as deformation, breaks, substance leaks, absence of display on the screen, etc.

In this manual, and on the instrument, the following symbols are used:



Warning: observe the instructions given in this manual; improper use could damage the instrument or its components.



High voltage danger: electrical shock hazard.



This symbol indicates that the clamp can operate on live conductors



Double-insulated meter




AC current



DC voltage



Connection to earth



Do not operate close to low frequency magnetic fields > 30A/m

1.1. PRELIMINARY INSTRUCTIONS

- This clamp has been designed for use in environments of pollution degree 2.
- It can be used for **CURRENT** measurements, on installations with CAT III 600V. For a definition of the above-mentioned categories, see § 1.4
- This instrument is not suitable for direct current measurements
- Please take the standard safety precautions aimed at protect you against dangerous electric currents and protect the instrument against incorrect use
- Do not test circuits exceeding the specified current and voltage limits
- Check that the battery is correctly inserted

1.2. DURING USE

Please carefully read the following recommendations and instructions:



CAUTION

Failure to comply with the Caution notes and/or Instructions may damage the instrument and/or its components or be a source of danger for the operator.

- Before switching on the clamp, remove the conductor from the clamp jaw.
- When the instrument is connected to the circuit under test, do not touch any unused terminal.
- During current measurement, any other current near the clamp may affect measurement precision.
- When measuring current, always put the conductor as near as possible to the middle of the clamp jaw, as described in § 4.3 in order to obtain the most accurate reading.
- While measuring, if the value or the sign of the quantity being measured remain unchanged, check if the HOLD function is enabled

1.3. AFTER USE

- When measurement is complete, switch off the clamp.
- If the instrument is not to be used for a long time, remove the battery.

1.4. DEFINITION OF MEASUREMENT (OVERVOLTAGE) CATEGORY

Standard IEC/EN61010-1: Safety requirements for electrical equipment for measurement, control and laboratory use, Part 1: General requirements” defines what measurement category, commonly called overvoltage category, is. In § 6.7.4: Measured circuits, circuits are divided into the following measurement categories:

(OMISSIS)

- **Measurement category IV** is for measurements performed at the source of the low-voltage installation.

Examples are electricity meters and measurements on primary overcurrent protection devices and ripple control units.

- **Measurement category III** is for measurements performed on installations inside buildings.

Examples are measurements on distribution boards, circuit breakers, wiring, including cables, bus-bars, junction boxes, switches, socket-outlets in the fixed installation, and equipment for industrial use and some other equipment, for example, stationary motors with permanent connection to fixed installation.

- **Measurement category II** is for measurements performed on circuits directly connected to the low-voltage installation.

Examples are measurements on household appliances, portable tools and similar equipment.

- **Measurement category I** is for measurements performed on circuits not directly connected to MAINS.

Examples are measurements on circuits not derived from MAINS, and specially protected (internal) MAINS-derived circuits. In the latter case, transient stresses are variable; for that reason, the standard requires that the transient withstand capability of the equipment is made known to the user.

2. GENERAL DESCRIPTION

The instrument carries out the following measurements:


- AC TRMS current
- AC TRMS leakage current
- Measurement compliance with IEC/EN6157-13 Class 2 guideline
- Bluetooth connection to mobile devices through HTLeakage APP

3. PREPARATION FOR USE

3.1. INITIAL CHECKS

Before shipping, the instrument has been checked from an electric as well as mechanical point of view. All possible precautions have been taken so that the instrument is delivered undamaged. However, we recommend generally checking the instrument in order to detect possible damage suffered during transport. In case anomalies are found, immediately contact the forwarding agent. We also recommend checking that the packaging contains all components indicated in § 7.3.1. In case of discrepancy, please contact the Dealer. In case the instrument should be replaced, please carefully follow the instructions given in § 8.

3.2. INSTRUMENT POWER SUPPLY


The instrument is supplied with two 1.5V AA LR06 batteries, included in the package. In order to prevent compromising its charge, the battery is not inserted in the instrument. For battery installation, follow the instructions given in § 6.2. The “” symbol appears when the battery is nearly discharged. Replace the battery, following the instructions given in § 6.2.

3.3. STORAGE

In order to guarantee precise measurement, after a long storage time under extreme environmental conditions, wait for the instrument to come back to normal condition (see § 7.2.1).

4. NOMENCLATURE

4.1. INSTRUMENT DESCRIPTION

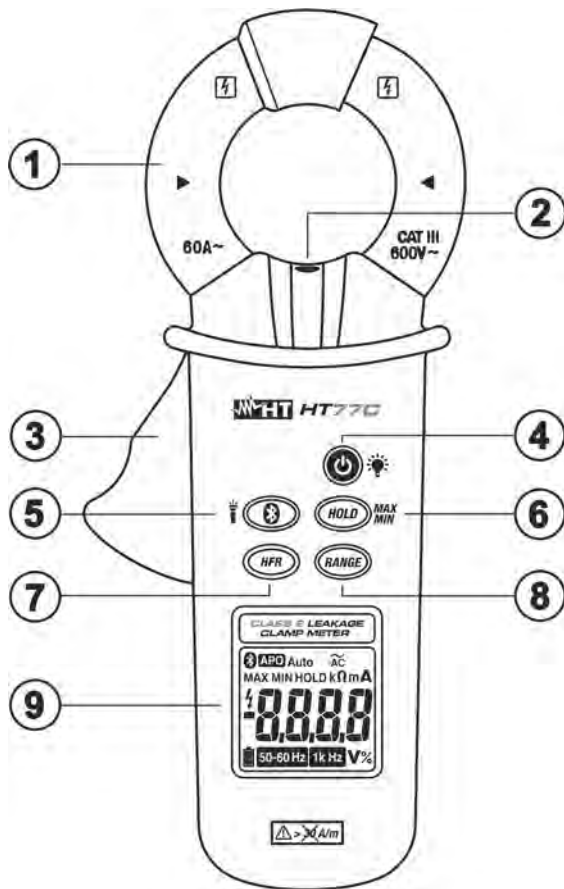


CAPTION:

1. Inductive clamp jaw
2. White LED torch
3. Opening lever
4. key
5. key
6. **HOLD/MAXMIN** key
7. **HFR** key
8. **RANGE** key
9. LCD display

Fig. 1: Instrument description

4.2. ALIGNMENT MARKS AND HAND PROTECTION

Put the conductor as close as possible to the middle of the jaws on the intersection of the indicated marks (see Fig. 2) in order to meet the meter accuracy specifications.

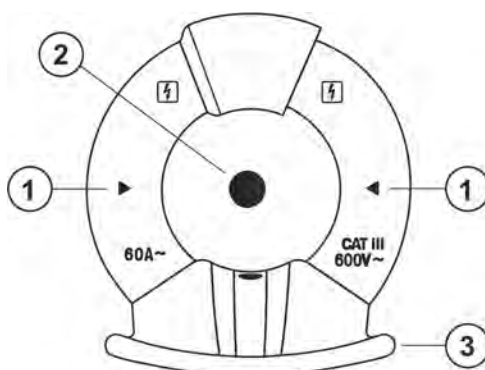

CAPTION:




1. Alignment marks
2. Cable
3. Hand protection

Fig. 2: Alignment marks and hand protection

Always keep your hands under the hand protection. This protection is always located in a suitable position to guarantee a correct safety distance from possible exposed or live parts (see Fig. 2)

4.3. DESCRIPTION OF FUNCTIONS KEYS

4.3.1. key

Press and hold the  key for 2s allows switching on the clamp. While switching on, the display shows the charge percentage of the power supply battery. Replace the batteries when the 0% appears (see § 6.2). To switch off the clamp, Press and hold the  key for 3s. With instrument switching on press the  to activate/deactivate the display backlight.

4.3.2. HOLD/MAXMIN key

The press of **HOLD/MAX/MIN** key allows to activate/deactivate the frozen of value on the display. The “HOLD” message is shown.

Press and hold the **HOLD/MAXMIN** key for 2s allows to activate the detection of the parameter maximum and minimum values. Both values are stored in memory and they can be shown cyclically when pressing “MIN MAX” key. The display shows the symbol linked to the selected function: “MAX” for maximum value, the symbol “MIN” for minimum value and the “MAX MIN” symbol for the for simultaneous detection of MAX and MIN. In this case the instrument return to normal measurement mode. Press and hold again the **HOLD/MAXMIN** key for 2s to exit from the function.



4.3.3. RANGE key

Press the **RANGE** key to activate the manual mode and to disable the Autorange function. The symbol “Auto” disappears from the display. Press the **RANGE** key to change measuring range: the relevant decimal point will change its position. In Autorange mode, the instrument selects the most appropriate ratio for carrying out measurement. If a reading is higher than the maximum measurable value, the indication “OL” appears on the display. Press and hold the **RANGE** key for 2s to exit the manual mode and restore the Autorange mode

4.3.4. HFR key


Pressing the **HFR (High Frequency Rejection)** key allows enabling the low-pass filter, which has a cutting frequency of approx. 200Hz (message “50-60Hz” on the display) or a low-pass filter, which has a cutting frequency of approx. 1kHz (message “1kHz” on the display) in order to eliminate the harmonic content on the measured current. Press the **HFR** key a third time to return to normal measurement mode.

4.3.5. key

Pressing the  key allows to activate/deactivate the Bluetooth connection. In this condition is possible to connect the instrument to an external mobile device through the dedicated HTLeakage APP (see § 5.3). Pressing the  key for 2s allows to activate/deactivate the white LED torch (see Fig. 1 – part 2)

4.3.6. Disabling the Auto Power Off function

In order to preserve internal batteries, the instrument switches off automatically approximately 20 minutes after it was last used. To disable the Auto Power Off function, proceed as follows:

- Switch off the instrument (**OFF**)
- Press and hold the **HFR** key and switch on the instrument with  key. The “AoFF” message is shown for a while and the “APO” symbol disappears on the display
- Switch off and then on again the instrument to enable the function

5. OPERATING INSTRUCTIONS

5.1. AC CURRENT MEASUREMENT



CAUTION

Insert the cable in the middle of the clamp jaws, in order to obtain accurate measures. Use the marks as a reference (see Fig. 2)

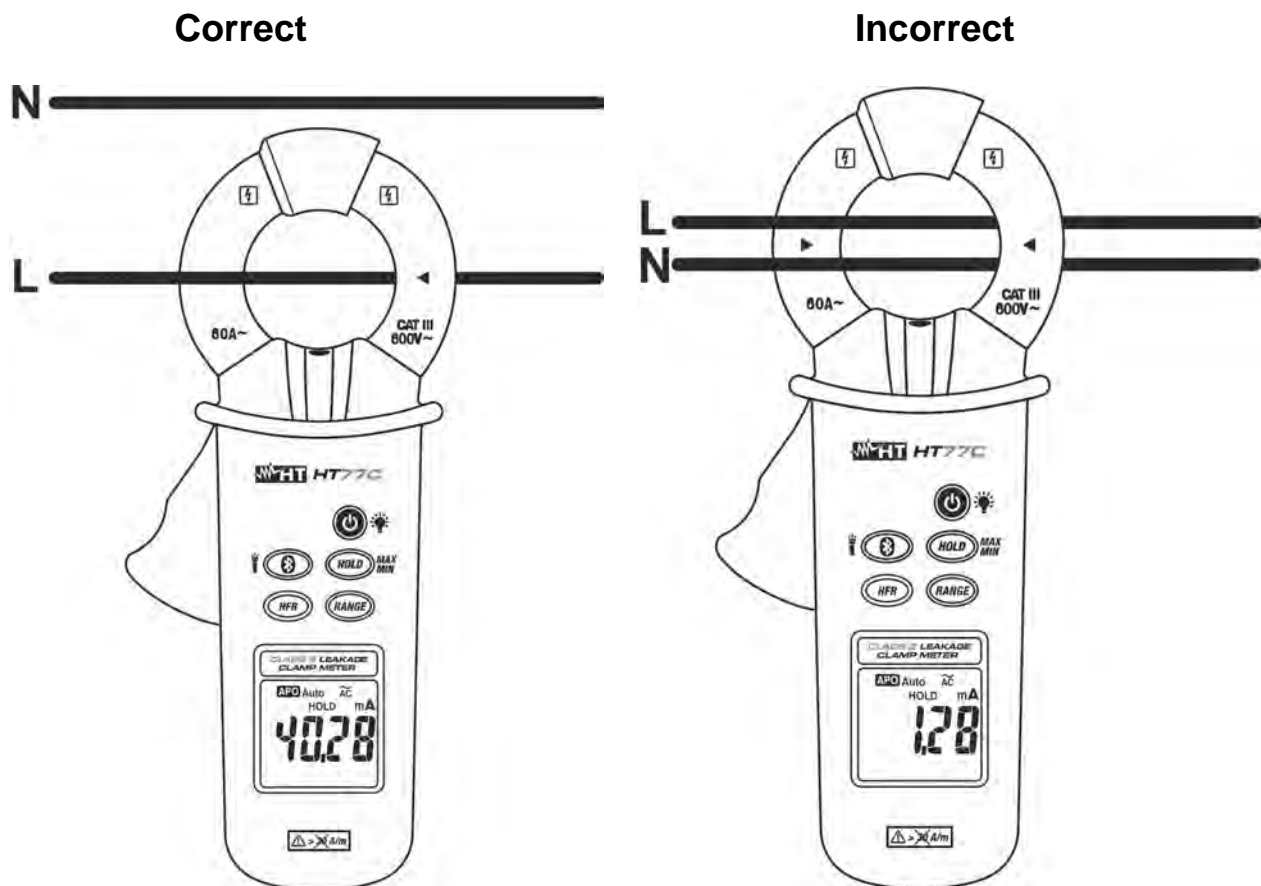


Fig. 3: Use of the clamp for AC current measurement

1. Switch on the clamp by pressing the key
2. Open the clamp jaw and insert the cable in the middle of it (see Fig. 3 – left part). The current value will be shown on the display
3. For use of HOLD, MAX/MIN, HFR and RANGE functions refer to § 4.3
4. For use of the instrument in combination with HTLeakage APP see § 5.3

5.2. LEAKAGE CURRENT MEASUREMENT



CAUTION

Insert the cable(s) in the middle of the clamp jaws, in order to obtain accurate measures. Use the marks as a reference (see Fig. 2)

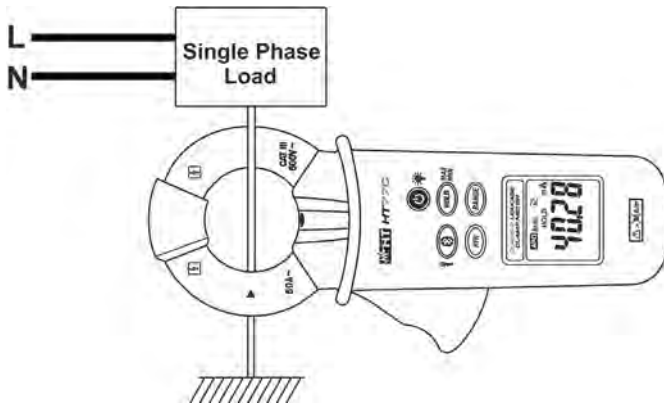


Fig. 4: Measuring leakage current with direct method in a single phase load

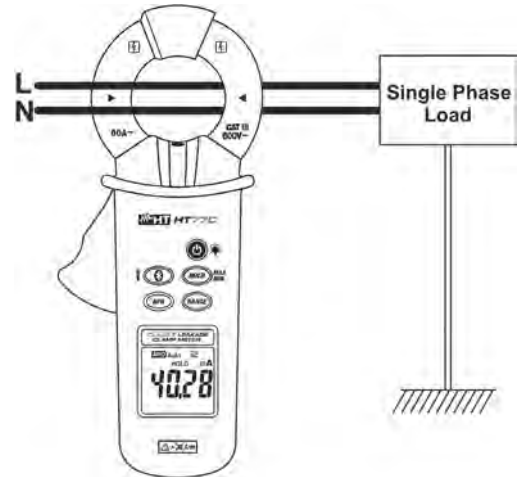


Fig. 5: Measuring leakage current with indirect method in a single phase load

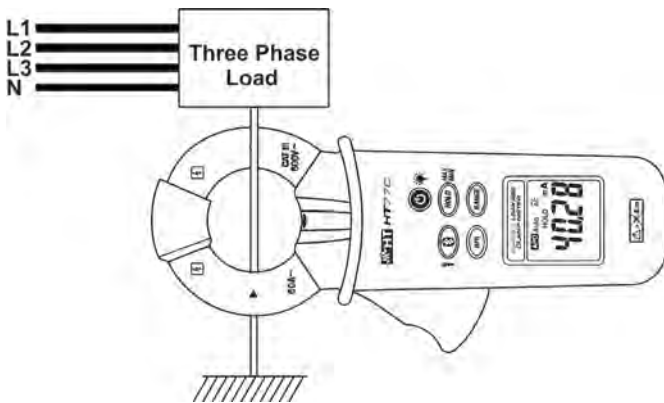


Fig. 6: Measuring leakage current with direct method in a three phase load

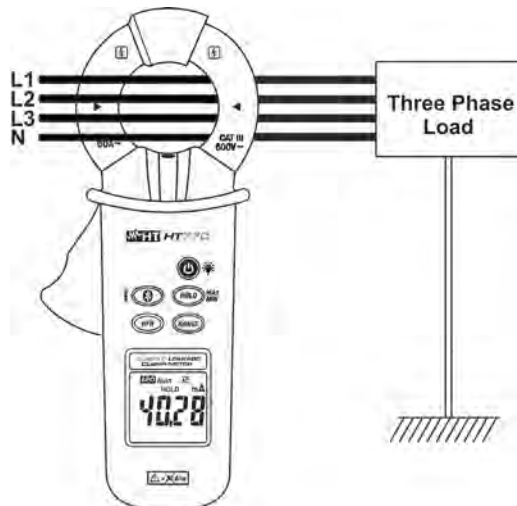


Fig. 7: Measuring leakage current with indirect method in a three phase load

Leakage current measurement with Direct method on earth conductors

1. Switch on the clamp by pressing the key
2. Open the clamp jaw and connect the clamp as shown in Fig. 4 or Fig. 6. The leakage current value will be shown on the display
3. For use of HOLD, MAX/MIN, HFR and RANGE functions refer to § 4.3
4. For use of the instrument in combination with HTLeakage APP see § 5.3

Leakage current measurement with Indirect method

1. Switch on the clamp by pressing the key
2. Open the clamp jaw and connect the clamp as shown in Fig. 5 or Fig. 7. The leakage current value will be shown on the display
3. For use of HOLD, MAX/MIN, HFR and RANGE functions refer to § 4.3
4. For use of the instrument in combination with HTLeakage APP see § 5.3

5.3. BLUETOOTH CONNECTION WITH HTLEAKAGE APP

The instrument is equipped with the integrated Bluetooth BLE 4.0 function that allows a wireless connection to mobile devices (tablets/smartphones) via the dedicated HTLeakage APP which can be free downloaded for Android and iOS systems using the following QR codes:

HTLeakage APP

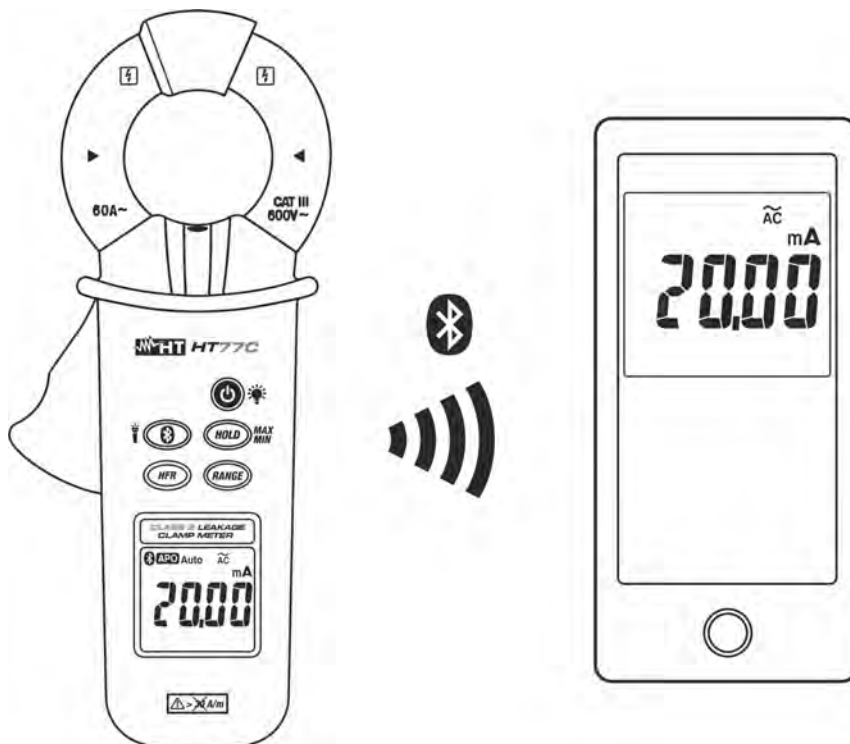


Fig. 8: Connection of instrument to a mobile device

The HTLeakage APP allows the following operations:

- Real-time visualization of the data on the mobile device
- Activation of data logger function for recording with programmable integration period from **1s to 5min**
- Graphical trend shown on mobile device
- Saving recording in CSV format
- Sharing by email and/or social networks

6. MAINTENANCE

6.1. GENERAL INFORMATION

1. The instrument you purchased is a precision instrument. While using and storing the instrument, carefully observe the recommendations listed in this manual in order to prevent possible damage or danger during use.
2. Do not use the instrument in environments with high humidity levels or high temperatures. Do not expose to direct sunlight.
3. Always switch off the instrument after use. In case the instrument is not to be used for a long time, remove the battery to avoid liquid leaks that could damage the instrument's internal circuits.

6.2. BATTERIES REPLACEMENT

When the LCD displays the “” symbol, replace the batteries



CAUTION

Only expert technicians should perform this operation.
Before carrying out this operation, make sure you have removed the cable being tested from inside the clamp jaw.

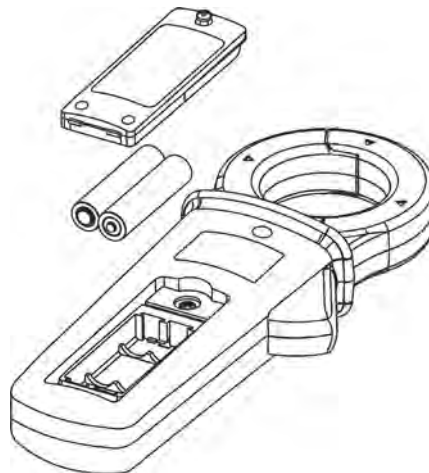


Fig. 9: Batteries replacement

1. Switch off the clamp
2. Remove the cable being tested from the clamp jaw
3. Loosen the three battery cover fastening screw and remove the cover
4. Remove the batteries from the cover
5. Fit two new batteries of the same type (see § 7.1.4) paying attention to correct polarity
6. Position the battery cover back over the compartment and fasten it with the relevant screws
7. Do not scatter old batteries into the environment. Use the relevant containers for disposal

6.3. CLEANING

Use a soft and dry cloth to clean the instrument. Never use wet cloths, solvents, water, etc.

6.4. END OF LIFE



CAUTION: the symbol on the instrument indicates that the appliance and its accessories must be collected separately and correctly disposed of.

7. TECHNICAL SPECIFICATIONS

7.1. TECHNICAL CHARACTERISTICS

Accuracy indicated as [%reading + (digit number*resolution)] at 23°C±5°C, <80%RH

AC TRMS Current

Range	Resolution	Accuracy (30Hz ÷ 50Hz)	Accuracy (51 ÷ 60Hz)	Accuracy (61Hz ÷ 1kHz)
6mA (*)	0.001mA	± (2.0%rdg+ 5dgt) (**)	± (1.0%rdg.+ 5dgt)	± (2.0%rdg+5dgt) (***)
60mA	0.01mA			
600mA	0.1mA			
6A	0.001A	± (2.0%rdg+ 5dgt)	± (1.0%rdg.+ 5dgt)	± (2.0%rdg+5dgt)
60A	0.01A			

(*) Minimum reading 10µA ; (**) Frequency response: 15Hz÷50Hz;. For frequency <30Hz add 3%rdg

(***) Frequency response: 60Hz÷10kHz. For frequency >1kHz add 0.5%rdg to the accuracy

Accuracy declared for sinusoidal waveform; Overload protection 60Arms;

Error due of position cable not in centre of jaws: ±1%rdg

Additional error due to the Crest Factor (CF) of non-sinusoidal signals:

C.F: 1.0 ÷ 2.0 → Add 1.0%rdg

C.F: 2.0 ÷ 2.5 → Add 2.5%rdg

C.F: 2.5 ÷ 3.0 → Add 4.0%rdg

Max. Crest Factor:

3.0 @ up to 3000dgt ; 2.0 @ 3000 ÷ 4500dgt; 1.5 @ 4500 ÷ 6000dgt

AC TRMS Current with 50-60Hz low-pass filter

Range	Resolution	Accuracy (30Hz ÷ 50Hz)	Accuracy (51 ÷ 60Hz)
6mA (*)	0.001mA	± (2.0%rdg+5dgt) (**)	± (1.0%rdg+5dgt)
60mA	0.01mA		
600mA	0.1mA		
6A	0.001A	± (2.0%rdg+5dgt)	± (1.0%rdg+5dgt)
60A	0.01A		

(*) Minimum reading 10µA ; (**) Frequency response: 15Hz÷50Hz;. For frequency <30Hz add 3%rdg

Error due of position cable not in centre of jaws: ±1%rdg

Cutting frequency: approx. 200Hz

Overload protection 60Arms

AC TRMS Current with 1kHz low-pass filter

Range	Resolution	Accuracy (30Hz ÷ 50Hz)	Accuracy (51 ÷ 60Hz)	Accuracy (61 ÷ 1kHz)
6mA (*)	0.001mA	± (2.0%rdg+5dgt) (**)	± (1.0%rdg+5dgt)	± (2.5%rdg+5dgt)
60mA	0.01mA			
600mA	0.1mA			
6A	0.001A	± (2.0%rdg+5dgt)	± (1.0%rdg+5dgt)	± (2.5%rdg+5dgt)
60A	0.01A			

(*) Minimum reading 10µA ; (**) Frequency response: 15Hz÷50Hz;. For frequency <30Hz add 3%rdg

Error due of position cable not in centre of jaws: ±1%rdg

Cutting frequency: approx. 1kHz

Overload protection 60Arms

7.1.1. Technical specifications for measures according to EC/EN61557-13 Class 2

- Reference guideline: IEC/EN61557-13, Class 2, $\leq 30\text{A/m}$ @ $I_n: 3.5\text{mA} \div 600\text{mA}$, $F_n: 40\text{Hz} \div 1\text{kHz}$
- NOTE1 → in the measurements according to IEC/EN61557-13 add the followed conditions to the general specifications
- NOTE2 → conditions valid for 6mA, 60mA e 600mA ranges

Intrinsic accuracy or parameter influencing the measurement	Designation code	Added specification
Position	E1	$\pm 1\%rdg$
Supply voltage	E2	No error added
Temperature	E3	$0.1 \times (\text{accuracy}) / ^\circ\text{C}$ ($<18^\circ\text{C}$ o $>28^\circ\text{C}$)
Non-sinusoidal waveform	E9	No error added
External magnetic field with frequency from 15Hz to 400Hz according to IEC61000-4-8	E11	Add error $\pm 10\mu\text{A}$ for $1\mu\text{T}$ (magnetic field)
Load current	E12	Add error $\pm 6\mu\text{A}$ for 1A (load current)
Surface current due to common mode voltage	E13	No error added
Frequency	E14	No error added
Repeatability	E15	No error added

7.1.2. Electrical specifications

Conversion type: TRMS
 Sample rate: 5 times / second
 Temperature coefficient: $0.1 \times (\text{accuracy}) / ^\circ\text{C}$, $<18^\circ\text{C}$ o $>28^\circ\text{C}$

7.1.3. Reference guidelines

Safety: IEC/EN61010-1, IEC/EN61010-2-032
 EMC: IEC/EN61326-1
 Application: IEC/EN61557-13, Class 2
 Insulation: double insulation
 Pollution level: 2
 Measurement category: CAT III 600V

7.1.4. General characteristics

Mechanical characteristics

Dimensions (L x W x H): 230 x 100 x 24mm (9 x 4 x 1in)
 Weight (battery included): 500g (18 ounces)
 Max. cable diameter: 40mm (2in)
 Mechanical protection: IP20

Power supply

Battery type: 2x1.5V batteries type AA LR03
 Low battery indication: symbol "□" at display
 Battery duration: approx. 60 hours
 Auto Power OFF: after 20 min of idleness

Communication interface

Bluetooth: BLE 4.0 (max distance 10m)

Display

Characteristics: 4 LCD, 6000 counts, decimal point, and backlight
 Over range indication: "OL" message at display

7.2. ENVIRONMENT

7.2.1. Environmental conditions for use

Reference temperature:	$23^{\circ} \pm 5^{\circ}\text{C}$ ($73^{\circ} \pm 41^{\circ}\text{F}$)
Operating temperature:	$-10^{\circ}\text{C} \div 30^{\circ}\text{C}$ ($14^{\circ}\text{F} \div 86^{\circ}\text{F}$) (RH \leq 80%) $30^{\circ}\text{C} \div 40^{\circ}\text{C}$ ($86^{\circ}\text{F} \div 104^{\circ}\text{F}$) (RH \leq 75%) $40^{\circ}\text{C} \div 50^{\circ}\text{C}$ ($104^{\circ}\text{F} \div 122^{\circ}\text{F}$) (RH \leq 45%)
Allowable relative humidity:	<80%RH
Storage temperature:	$-20 \div 60^{\circ}\text{C}$ ($-4^{\circ}\text{F} \div 140^{\circ}\text{F}$)
Storage humidity:	<80%RH
Max height of use:	2000m (6562 ft)
Vibration:	according to MIL-PRF-28800F Class 2

This instrument satisfies the requirements of Low Voltage Directive 2014/35/EU (LVD) and of EMC Directive 2014/30/EU

This instrument satisfies the requirements of 2011/65/EU (RoHS) directive and 2012/19/EU (WEEE) directive

7.3. ACCESSORIES

7.3.1. Standard accessories

- Carrying case
- Batteries (not fitted)
- User manual

8. SERVICE

8.1. WARRANTY CONDITIONS

This equipment is guaranteed against material faults or production defects, in accordance with the general sales conditions. During the warranty period (one year), faulty parts may be replaced. The manufacturer reserves the right to decide either to repair or replace the product. In case of returning of the instrument, all transport charges must be paid by the customer. The instrument must be accompanied by a delivery note indicating the faults or reasons of returning. The returned tester must be packed in its original box. Any damage occurred in transit because of lack of original packaging will be debited to the customer. The manufacturer is not responsible for any damage against persons or things. Accessories and batteries are not covered by warranty.

The warranty shall not apply in the following cases:

- Repair and/or replacement of accessories and battery (not covered by warranty).
- Repairs that may become necessary as a consequence of an incorrect use of the instrument or due to its use together with non-compatible appliances.
- Repairs that may become necessary as a consequence of improper packaging.
- Repairs which may become necessary as a consequence of interventions performed by unauthorized personnel.
- Modifications to the instrument performed without the manufacturer's explicit authorization.
- Use not provided for in the instrument's specifications or in the instruction manual.

The content of this manual cannot be reproduced in any form without the manufacturer's authorization.

Our products are patented and our trademarks are registered. The manufacturer reserves the right to make changes in the specifications and prices if this is due to improvements in technology

8.2. SERVICE

If the instrument does not operate properly, before contacting the After-sales Service, please check the conditions of batteries and replace them, if necessary. Should the instrument still operate improperly, check that the product is operated according to the instructions given in this manual. Should the instrument be returned to the After-sales Service or to a Dealer, transport will be at the Customer's charge. However, shipment will be agreed in advance. A report will always be enclosed to a shipment, stating the reasons for the product's return. Only use original packaging for shipment; any damage due to the use of non-original packaging material will be charged to the Customer.